



Quality Assure In China

China Inspection  
OfficeHK QGS LIMITED  
Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup>,2022

Total page: 63

## GENERAL SUMMARY:

Client:	Designlink Central	
Attn:	Natálie Dunajská	
PO/No.:	301581	
Product Name :	Chair	
Supplier:	Bazhou yuyang furniture Co. LTD	
Insp. Location:	Bazhou city, Hebei China	
Inspector:	Leo	
Date of inspection.:	2022-07-10	

## AVAILABLE QUANTITY:

Order No.	Item no.	Order Qty	Packed	Not packed	Not finished	Inspect Qty
301581	JUSTIN, black	300	300	0	0	25
	JUSTN, white	130	130	0	0	12
	SCANDINAVIA BEECH, black / natural	100	100	0	0	10
	SCANDINAVIA BEECH, yellow/ natural	140	140	0	0	13
	SCANDINAVIA ECONOMY, white	90	90	0	0	10
	SCANDINAVIA ECONOMY, yellow	100	100	0	0	10

Inspection standard: [ANSI/ASQC Z1.4-2003](#)Sampling plan: *Single, Normal*

Inspection level: II

AQL: Critical: Not Allowed.

## Sample Size:80pcs

	Critical	Major	Minor
AQL:	0	2.5	4.0
Defects Found:	0	3	3
Max. Allowed:	0	5	7

## OVERALL CONCLUSION:

Inspection criteria	Passed	Failed	Pending	Comments
Quantity available:	X	-	-	OK
Workmanship:	X	-	-	OK
Test:	X	-	-	OK
Data measurement:	-	-	X	See remark 2
Labeling:	X	-	-	OK
Shipping mark:	X	-	-	OK

This report only reflects the truth of quality in this lots goods, based on statistical sampling procedure. Inspection is performed to the best of our ability and skills but without responsibility on our part, nor does it evidence shipment. Our Website: [www.qgs.com.cn](http://www.qgs.com.cn)



Quality Assure In China

China Inspection  
OfficeHK QGS LIMITED  
Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup>, 2022

Total page: 63

Result: ☐ Acceptable ☐ Reject ☒ Pending

## SPECIAL REMARK:

1.The factory is ready for silica gel. There will be two bags for each container.



2.Actual product size were not conform to the spec, please refer to "PACKING AND ACCESSORIES".

## WORKMANSHIP:

Item No.	Check Qty	Defects Description	Cri	Maj	Min
JUSTIN, black	25	Scratch mark of chair leg	0	1	0
		Missing plastic feet of chair leg	0	1	0
JUSTN, white	12	Loose plastic feet of chair leg	0	0	1
SCANDINAVIA BEECH, black / natural	10	Scratch mark	0	1	0
SCANDINAVIA BEECH, yellow/ natural	13	Not was found defects	0	0	0
SCANDINAVIA ECONOMY, white	10	Glue mark on chair leg	0	0	1
SCANDINAVIA ECONOMY, yellow	10	Bad grain of chair leg	0	0	1
Defects found:			0	3	3
Max allow:			0	5	7
Result:			Passed		

## TEST AND MEASUREMENT:

This report only reflects the truth of quality in this lots goods, based on statistical sampling procedure. Inspection is performed to the best of our ability and skills but without responsibility on our part, nor does it evidence shipment. Our Website: [www.qgs.com.cn](http://www.qgs.com.cn)



Quality Assure In China

China Inspection  
OfficeHK QGS LIMITED  
Final Random Inspection Report

Client Ref. No.: 2216	Report No.:2216008		Date: July 10 <sup>th</sup> ,2022		Total page: 63
Test items	Sample size	Passed	Failed	Pending	Comments
Product dimension:	3pcs	x	-	-	OK
Function test:	32pcs	x	-	-	OK
Weight test:	2pcs	x	-	-	OK
Static load test	3pcs	x	-	-	OK
Steady test	3pcs	x	-	-	OK
Assembly test	4pcs	x	-	-	OK
Moisture test	3pcs	x	-	-	OK
Color rub test	3pcs	x	-	-	OK
Adhesion test	1pcs	x	-	-	OK

## LABEL CHECK:

Label	Sample size	Passed	Failed	Pending	Comments
-	-	-	-	-	N/A

## PACKING AND ACCESSORIES:

Item No.:	Master shipper (pcs/ctn )	Carton size L×W×H (mm)	G.W (Kgs)	N.W (Kgs)	Product size actual finding(Spec)	Product Barcode
JUSTIN-white	2	55.5x57.8x52.5	9.98	4.04	55.5x49.5x84cm	9990005901741
JUSTIN-black	2		9.63	3.83	(spec:55x48x80cm)	9990005901727
SCANDINAVIA BEECH-black	2	64.5x53.7x37.5	11.75	5.05	52.5x50x84.5cm	9990005901642
SCANDINAVIA BEECH-yellow	2		11.66	4.97	(spec:55x48x80cm)	9990005901703
SCANDINAVIA ECONOMY-white	2	65.5x59.5x37.5	10.45	4.38	56x49.5x81cm	8911121846014
SCANDINAVIA ECONOMY-yellow	2		10.67	4.36	(spec:55x48x80cm)	8911121846021

## EXPORT CARTON INFORMATION:

Carton:	New export carton	Yes	Sealing:	Opaque gummed tape	/
Fastening:	Metal staples	NO		Transparent gummed tape	Yes
Strapping:	Nylonx2	NO		Paper tape	/
Material:	Ply of corrugated paper	5 Ply	Others:	-	

## PRODUCT AND DEFECTS PHOTO SHOW:

This report only reflects the truth of quality in this lots goods, based on statistical sampling procedure. Inspection is performed to the best of our ability and skills but without responsibility on our part, nor does it evidence shipment. Our Website: [www.qgs.com.cn](http://www.qgs.com.cn)



Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup>, 2022

Total page: 63



Finished goods in warehouse



Finished goods in warehouse



Finished goods in warehouse



Finished goods in warehouse

**Item JUSTIN**

**Item JUSTIN-Black**





Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup>,2022

Total page: 63



Master carton view




Shipping mark



Shipping mark



Side mark

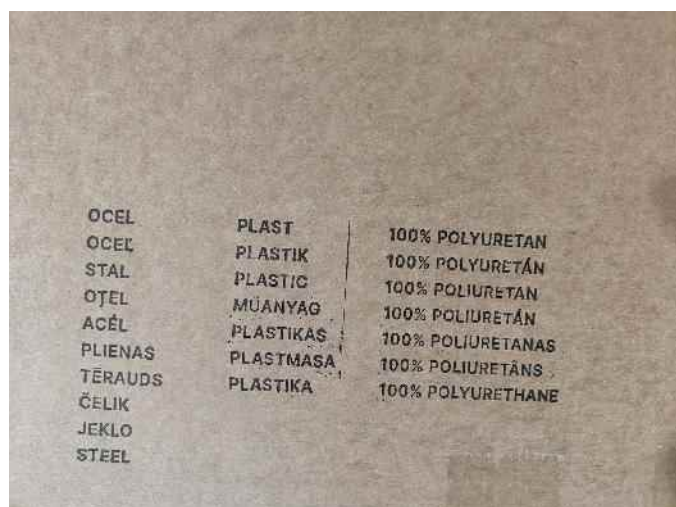

Side mark



Barcode



Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup>, 2022


Total page: 63



Side mark



Side mark

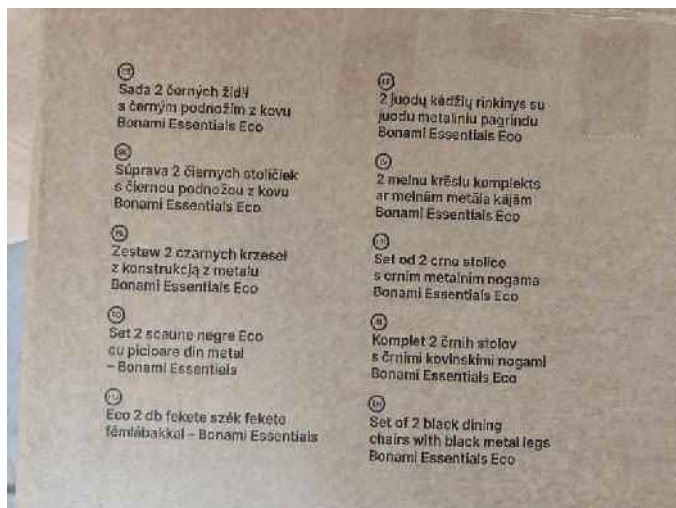

Side mark



Side mark



Side mark



Side mark





Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup> ,2022

Total page: 63



Open carton view



Packing view



Packing view



Packing view



Packing view



Packing view



Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup>,2022

Total page: 63



Packing view



Packing view



Packing view



Packing view



Packing view



Packing view





Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup> ,2022

Total page: 63



Chair back view



Chair back view



Chair seat view



Chair seat view



Chair leg view



tag view



Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup> ,2022


Total page: 63




All parts view




IM

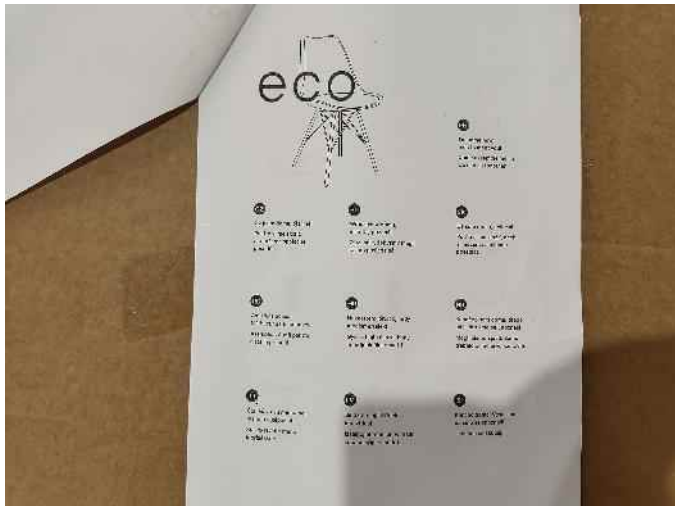


IM

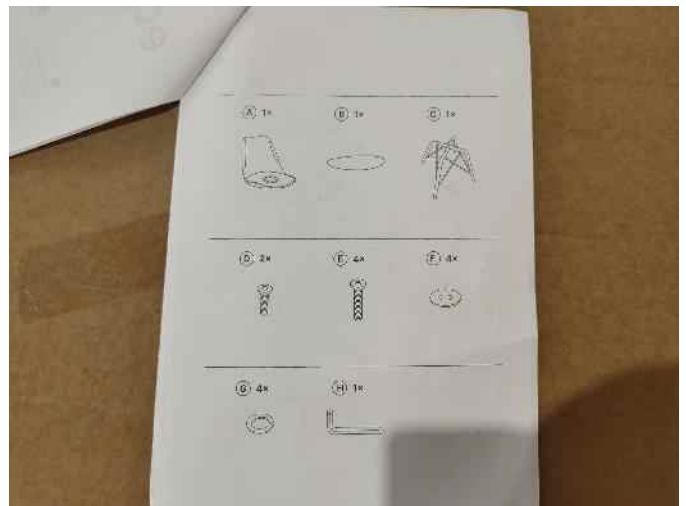

IM

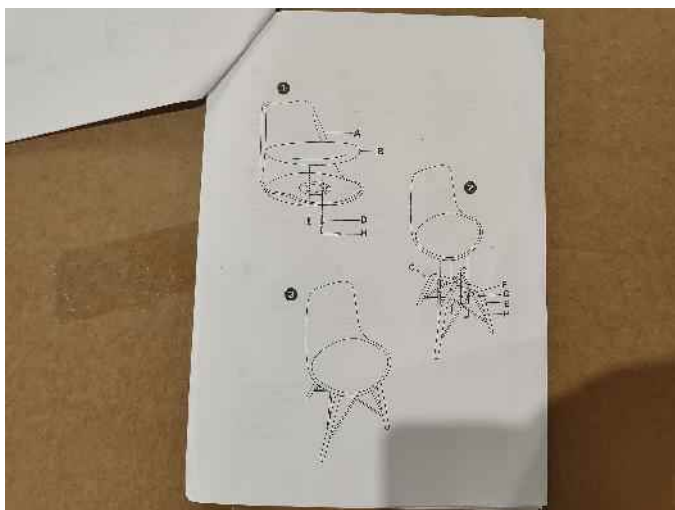

IM

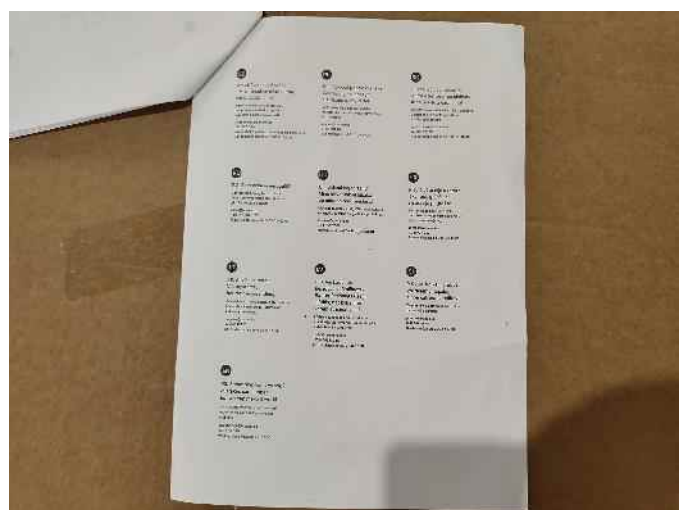

IM



Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup> ,2022

Total page: 63



IM



Spare parts



Assembly process



Assembly process



Product view



Product view





Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED

## Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup> ,2022

Total page: 63



Product view



Product view



Product view



Product view



Product size test



Product size test:49.5cm



Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup>, 2022

Total page: 63



Product size test



Product size test:49cm



Product size test



Product size test:84cm



Product size test



Product size test:55.5cm



Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup> ,2022

Total page: 63



Product weight test



Product weight test:3.875kgs



JUSTIN- black: scratch mark-major



JUSTIN- black: missing of plastic feet -major

## Item JUSTIN-White



Master carton view



Shipping mark

This report only reflects the truth of quality in this lots goods, based on statistical sampling procedure. Inspection is performed to the best of our ability and skills but without responsibility on our part, nor does it evidence shipment. Our Website: [www.qgs.com.cn](http://www.qgs.com.cn)





Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216


Report No.:2216008

Date: July 10<sup>th</sup>, 2022

Total page: 63



Shipping mark

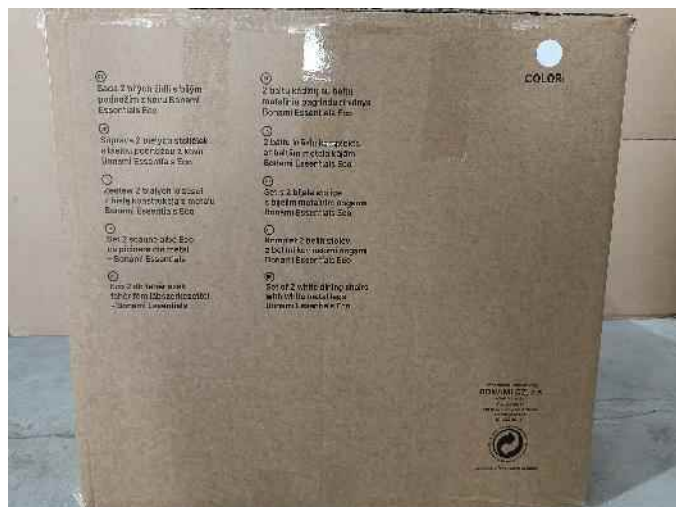


Side mark



Side mark



Side mark

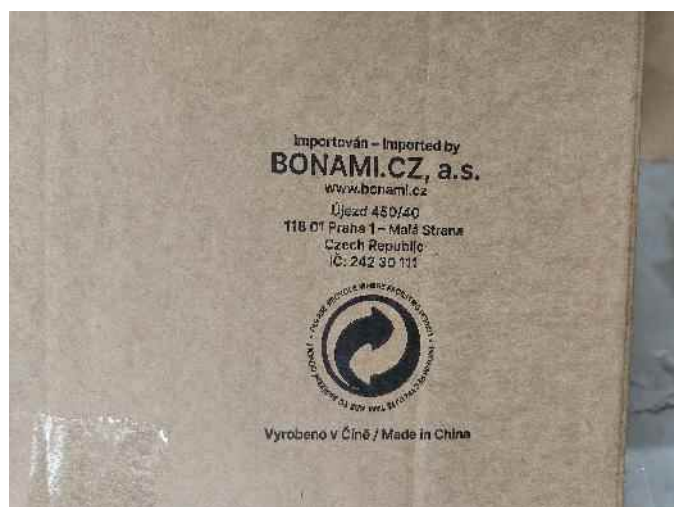

Side mark



Side mark



Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup>,2022

Total page: 63



Side mark



Side mark



Barcode



Open carton view



Packing view



Packing view





Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup> ,2022

Total page: 63



Packing view



Packing view



Packing view



Packing view



Packing view



Packing view





Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED

## Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup> ,2022

Total page: 63



Packing view



Packing view



Chair back view



Chair back view



Chair seat view



Chair seat view



Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup> ,2022

Total page: 63




Chair leg view




Chair leg view




IM

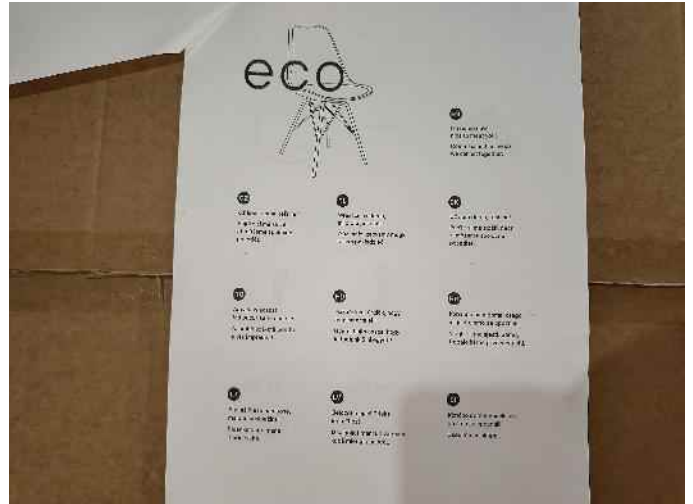

IM

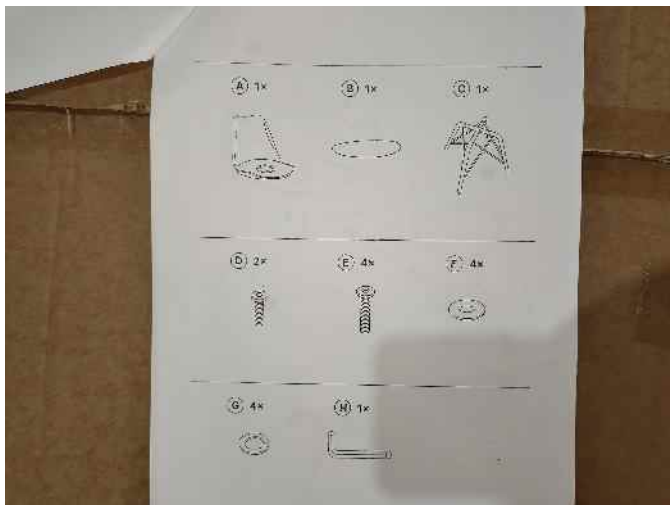

IM

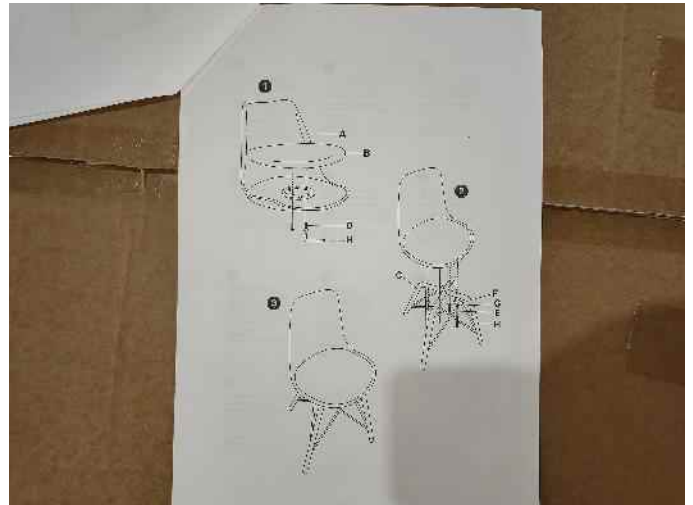

IM



Quality Assure In China

China Inspection  
Office


# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup> ,2022

Total page: 63

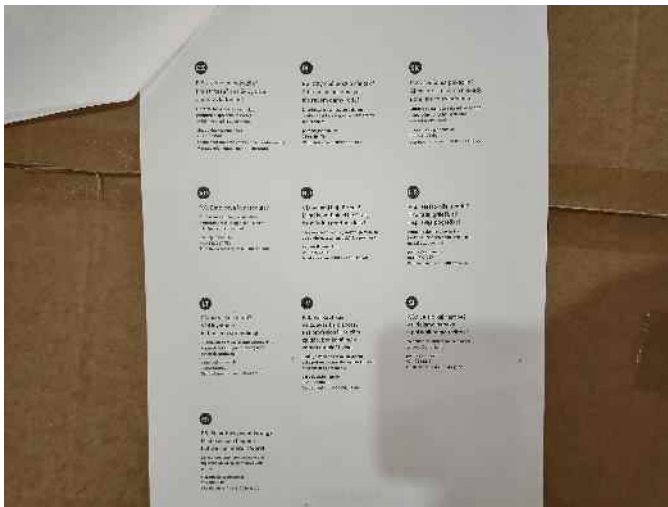

IM



IM



IM



Spare parts



Assembly process



Assembly process





Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup> ,2022

Total page: 63



Product view



Product view



Product view



Product view



Product view



Product view



Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup> ,2022

Total page: 63



N/A

JUSTIN- white: loose of plastic feet-minor

N/A

## Item SCANDINAVIA BEECH

### Item SCANDINAVIA BEECH-yellow/natural



Master carton view



Shipping mark



Quality Assure In China

China Inspection  
Office


# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup> ,2022

Total page: 63

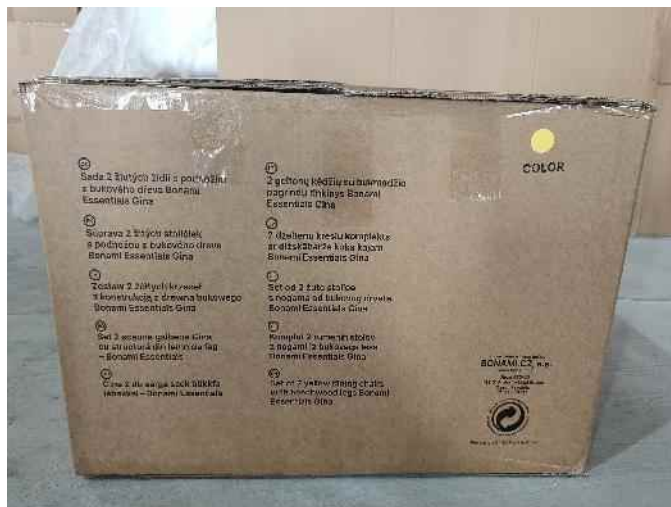

Side mark



Side mark



Side mark



Side mark



Side mark



Side mark





Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED

## Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup> ,2022

Total page: 63



Side mark



Barcode



Open carton view



Packing view



Packing view



Packing view



Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup> ,2022

Total page: 63



Packing view



Packing view



Packing view



Packing view



Packing view



Packing view





Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup> ,2022

Total page: 63



Packing view



Packing view



Packing view



Packing view



Chair leg view



Chair leg view





Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED

## Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup> ,2022

Total page: 63



Chair back view



Chair back view



Chair seat view



Chair seat view



Base view



Base view



Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216


Report No.: 2216008

Date: July 10<sup>th</sup>, 2022


Total page: 63




IM

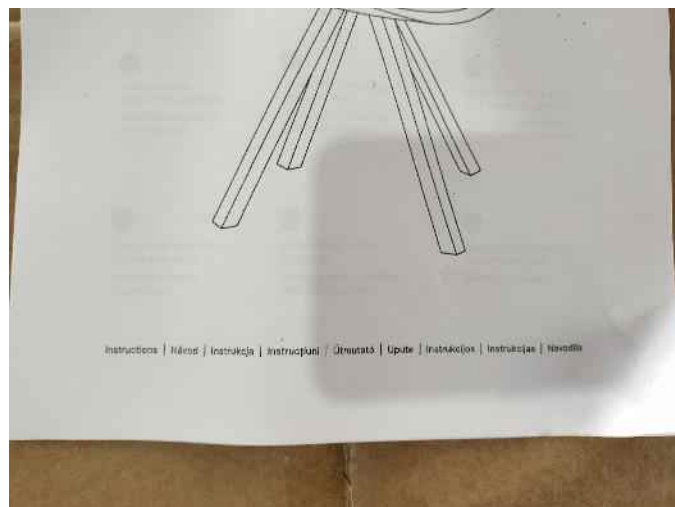


IM

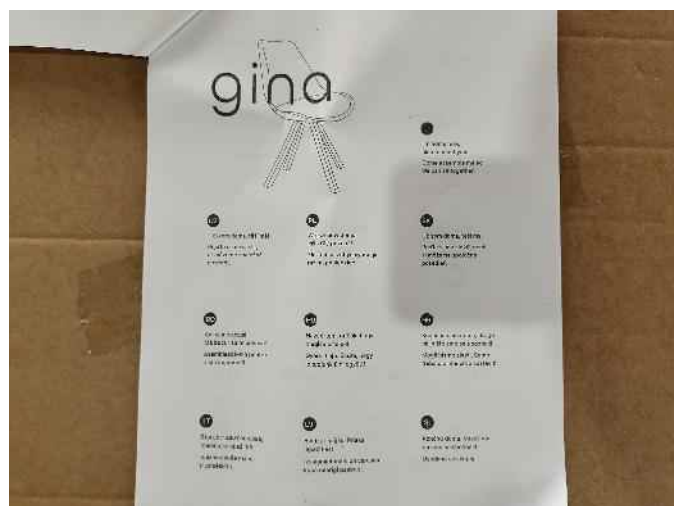


IM

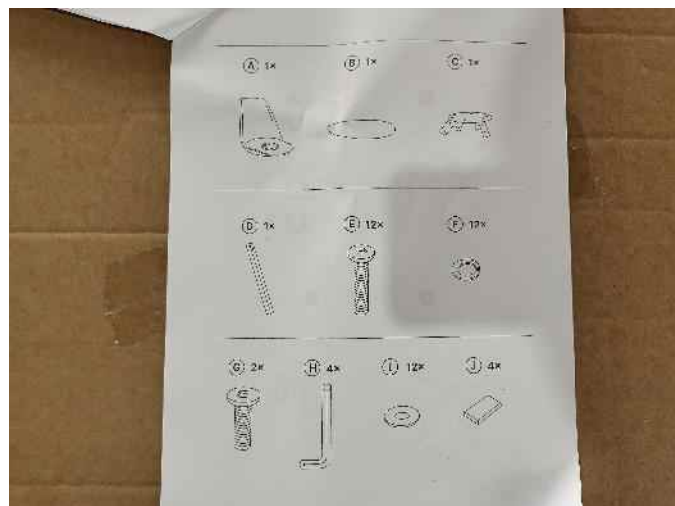

IM

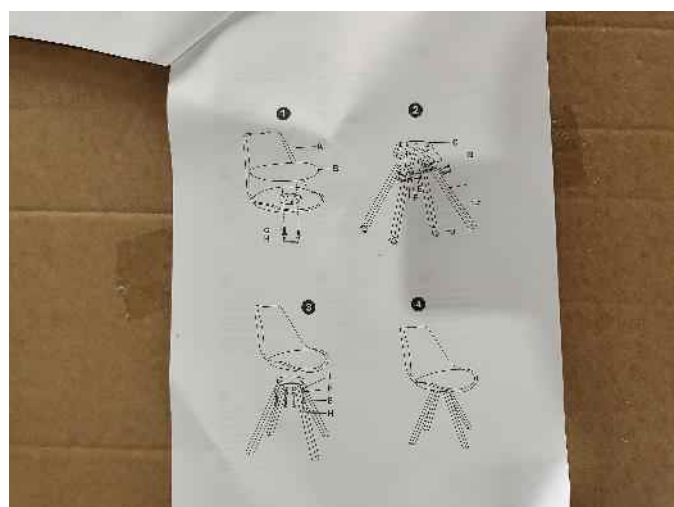

IM

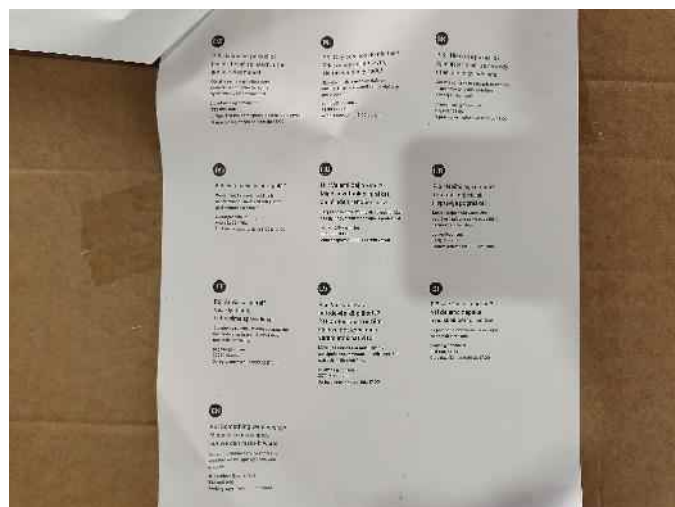

IM



Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup> ,2022

Total page: 63



IM



Spare parts




All parts view



Assembly process



Assembly process

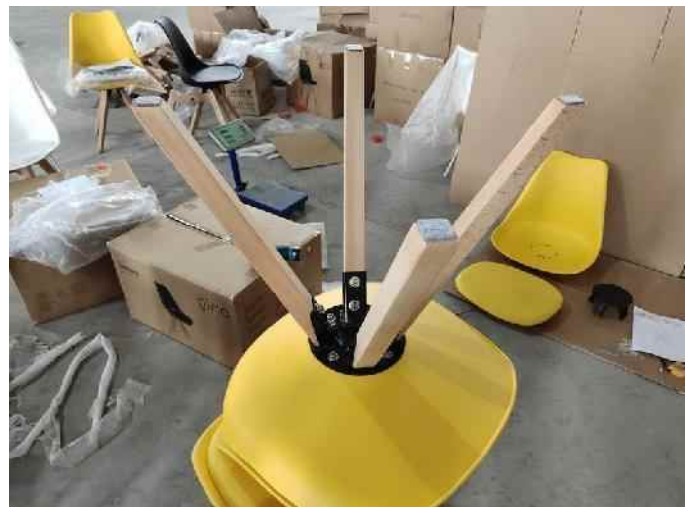

Assembly process





Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup>,2022

Total page: 63



Product view



Product view



Product view



Product view



Product view



Product view



Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup> ,2022

Total page: 63



Product size test



Product size test:50cm



Product size test



Product size test:49cm



Product size test



Product size test:84.5cm



Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup> ,2022

Total page: 63



Product size test



Product size test:52.5cm



Product weight test



Product weight test:4.975kgs

**Item SCANDINAVIA BEECH-black/natural**



Master carton view



Shipping mark

This report only reflects the truth of quality in this lots goods, based on statistical sampling procedure. Inspection is performed to the best of our ability and skills but without responsibility on our part, nor does it evidence shipment. Our Website: [www.qgs.com.cn](http://www.qgs.com.cn)





Quality Assure In China

China Inspection  
Office


# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216


Report No.:2216008

Date: July 10<sup>th</sup> ,2022

Total page: 63

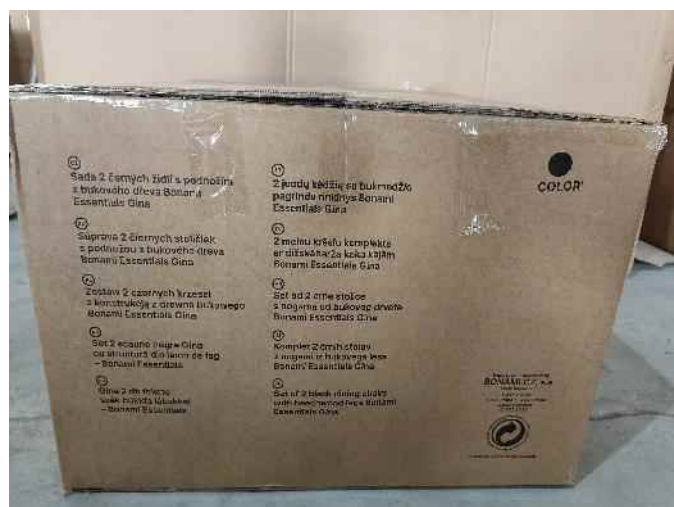


Side mark

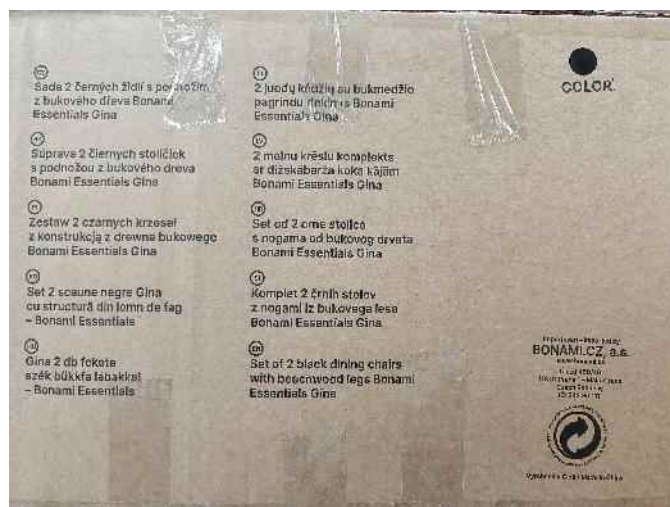

Side mark



Side mark

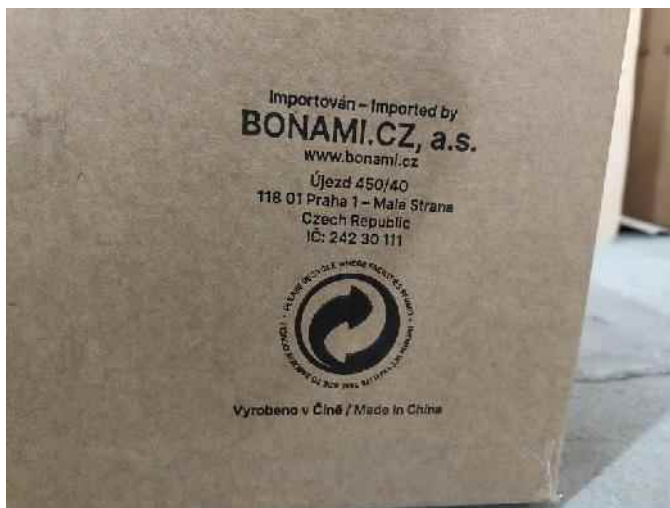

Side mark



Side mark



Side mark



Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup>, 2022

Total page: 63



Side mark



Barcode



Open carton view



Packing view



Packing view



Packing view





Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup> ,2022

Total page: 63



Packing view



Packing view



Packing view



Packing view



Packing view



Packing view





Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup> ,2022

Total page: 63



Packing view



Chair leg view



Chair leg view



Packing view



Base view



Base view



Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup> ,2022

Total page: 63



Chair back view



Chair back view




Chair seat view



Chair seat view



IM

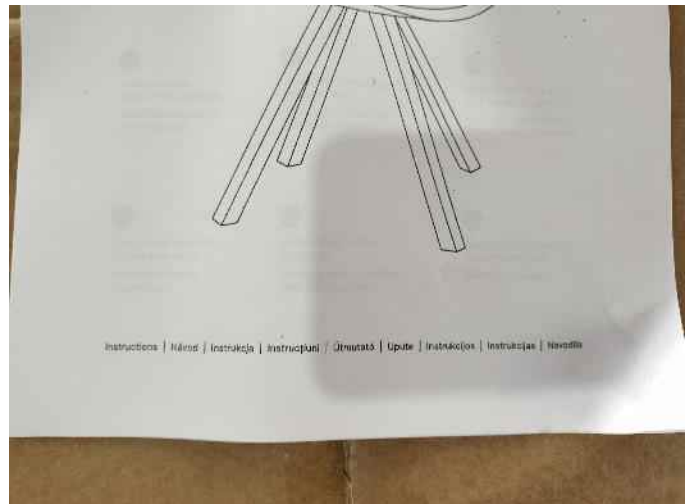

IM



Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216


Report No.:2216008

Date: July 10<sup>th</sup> ,2022


Total page: 63




IM

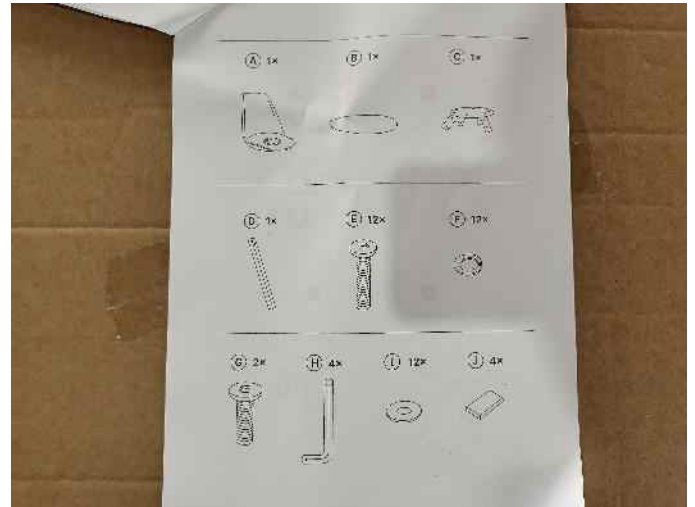

IM

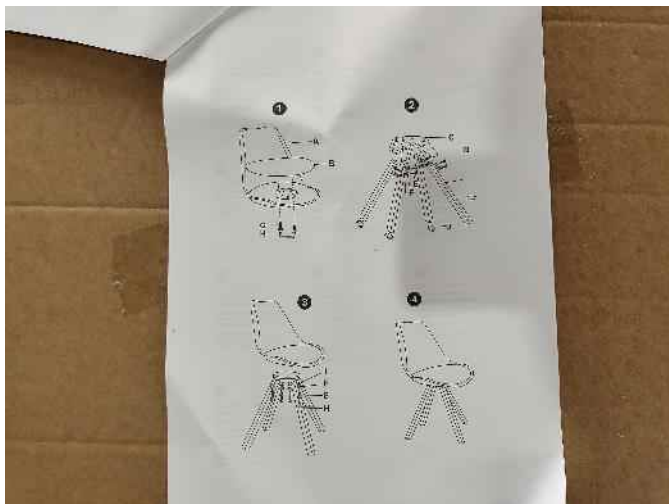

IM

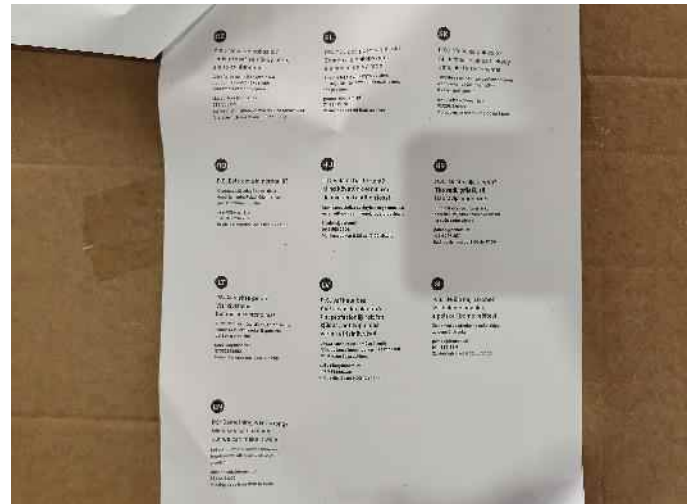

IM



IM



Spare parts





Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup> ,2022

Total page: 63



All parts view



Assembly proces



Product view



Product view



Product view



Product view



Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup> ,2022

Total page: 63



Product view



Product view



SCANDINAVIA BEECH: scratch mark on chair back-minor

N/A

N/A

**ITEM SCANDINAVIA ECONOMY**

**Item SCANDINAVIA ECONOMY-yellow**



Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup> ,2022

Total page: 63



Master carton view




Shipping mark




Side mark



Side mark

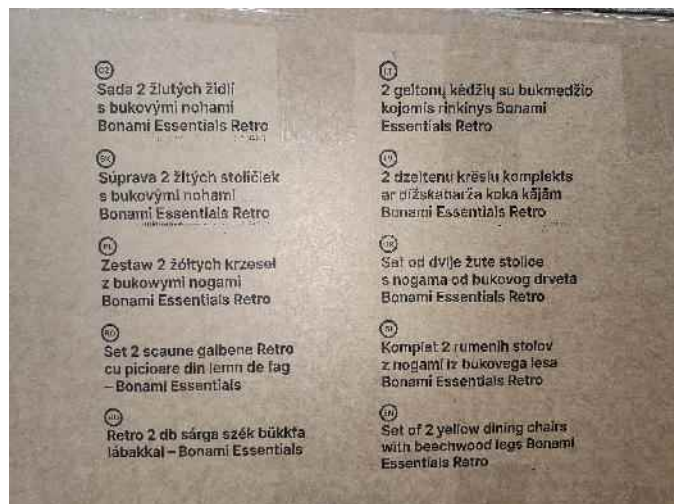

Side mark

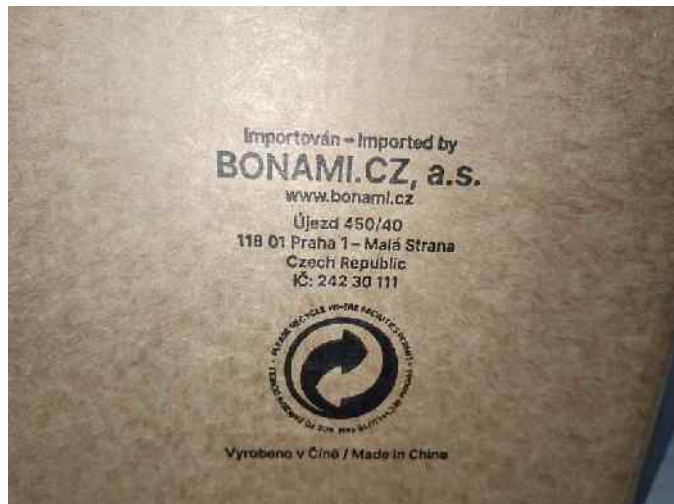

Side mark





Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup>,2022

Total page: 63



Side mark




Side mark



Side mark



Side mark

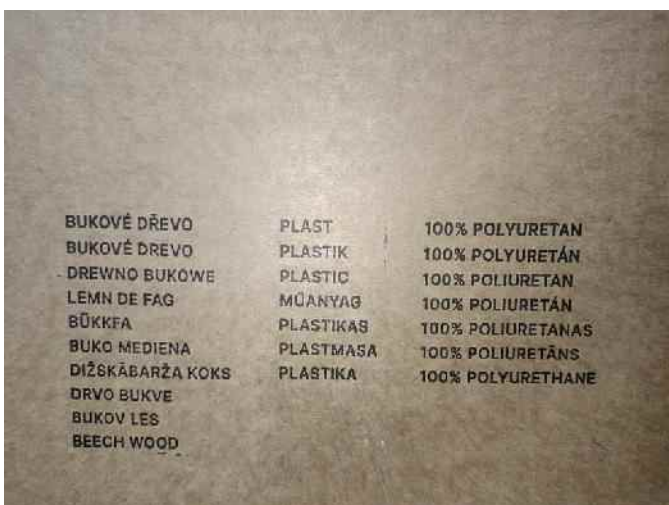

Barcode



Barcode



Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup> ,2022

Total page: 63



Open carton view



Packing view



Packing view



Packing view



Packing view



Packing view





Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup> ,2022

Total page: 63



Packing view



Packing view



Tag view



Chair leg view



Packing view



Packing view





Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED

## Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup> ,2022

Total page: 63



Packing view



Packing view



Chair back view



Chair back view



Chair seat view



Chair seat view



Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216


Report No.:2216008

Date: July 10<sup>th</sup>, 2022


Total page: 63




IM

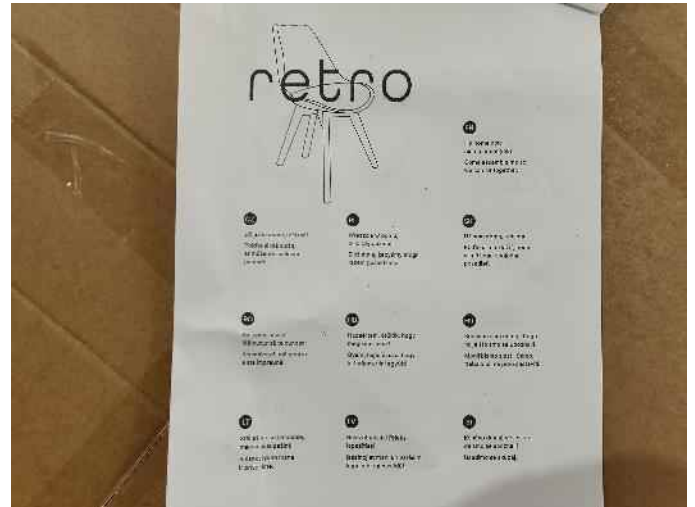


IM

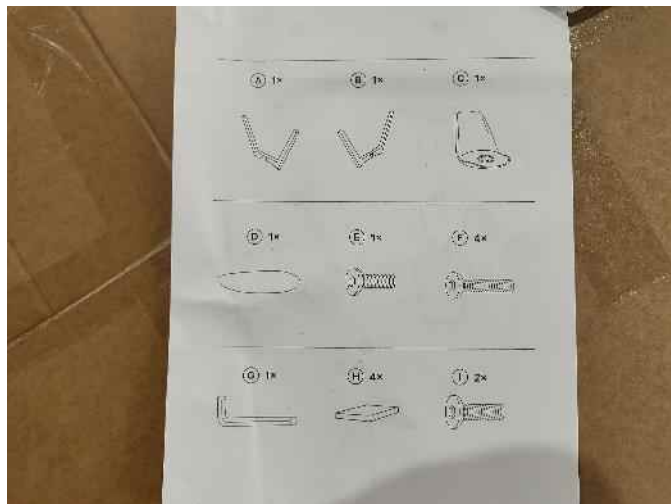

IM

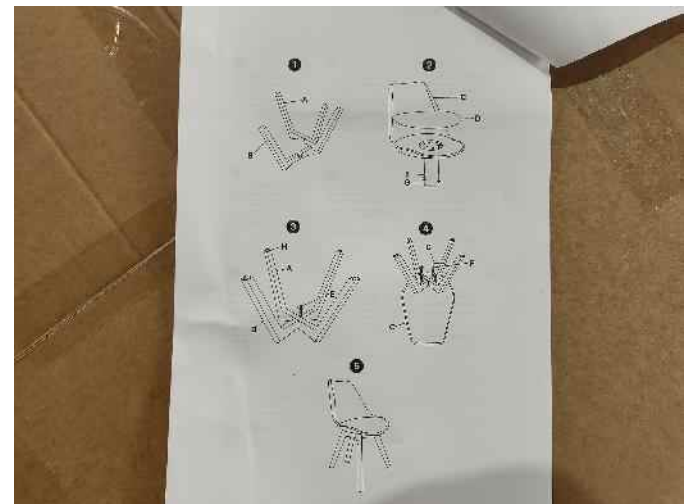

IM

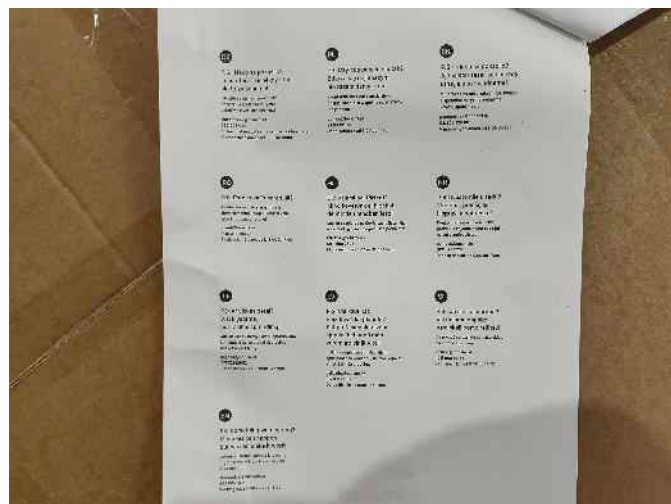

IM



IM





Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup> ,2022


Total page: 63



Spare parts



IM

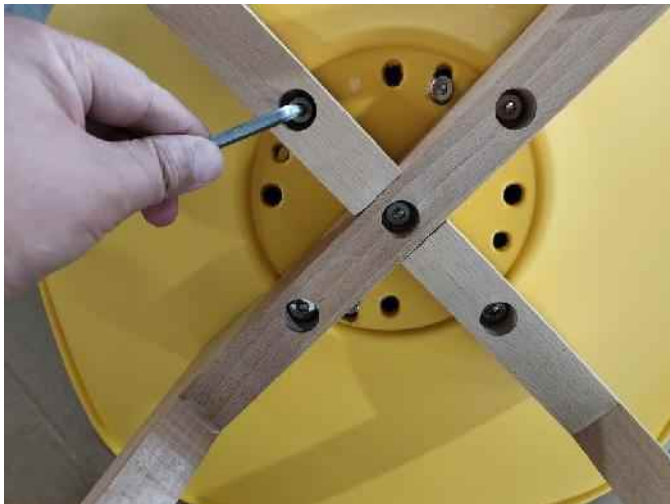

Assembly process



Assembly process



Product view



Product view





Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED

## Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup>, 2022

Total page: 63



Product view



Product view



Product view



Product view



Product size test



Product size test:49.7cm



Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup>, 2022

Total page: 63



Product size test



Product size test:48.5cm



Product size test



Product size test:81cm



Product size test



Product size test:56cm



Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup>,2022

Total page: 63



Product weight test



Product weight test:4.36kgs



SCANDINAVIA ECONOMY: bad grain-minor

N/A

N/A

Item SCANDINAVIA ECONOMY-white



Master carton view



Shipping mark

This report only reflects the truth of quality in this lots goods, based on statistical sampling procedure. Inspection is performed to the best of our ability and skills but without responsibility on our part, nor does it evidence shipment. Our Website: [www.qgs.com.cn](http://www.qgs.com.cn)





Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup>, 2022


Total page: 63



Side mark



Side mark

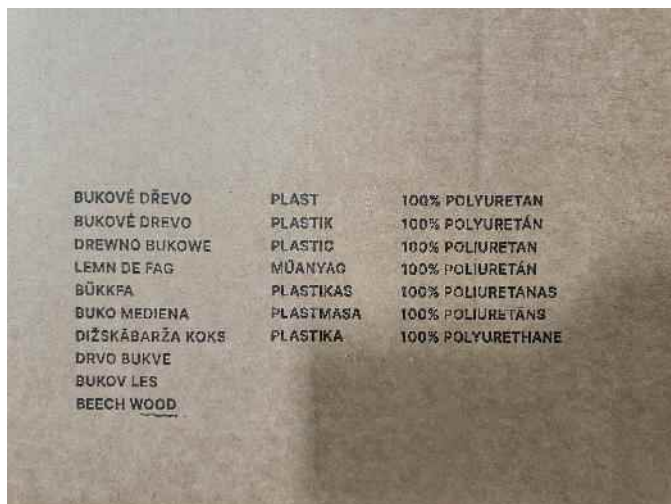

Side mark



Side mark



Barcode



Side mark



Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216


Report No.:2216008

Date: July 10<sup>th</sup> ,2022

Total page: 63



Side mark

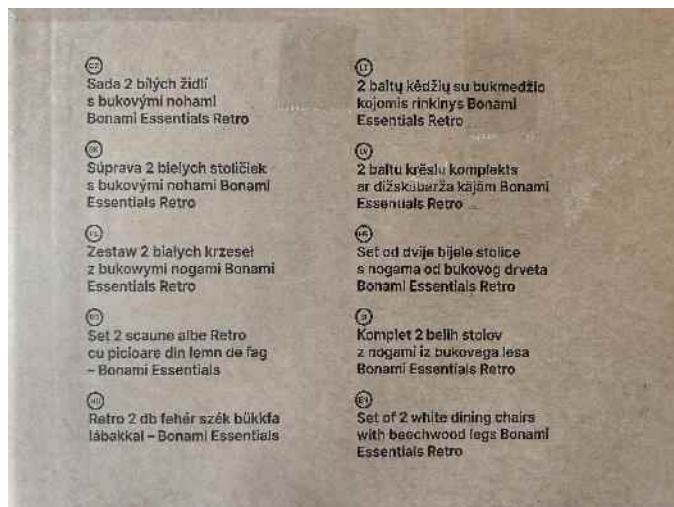

Side mark



Side mark



Side mark



Open carton view



Packing view





Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup> ,2022

Total page: 63



Packing view



Packing view



Packing view



Packing view



Packing view



Packing view





Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup> ,2022

Total page: 63



Packing view



Packing view



Packing view



Packing view



Packing view



Chair leg view



Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup> ,2022

Total page: 63



Chair leg view



Chair leg view



Chair back view



Chair back view



Chair seat view



Chair seat view



Quality Assure In China

China Inspection  
Office


# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup> ,2022

Total page: 63

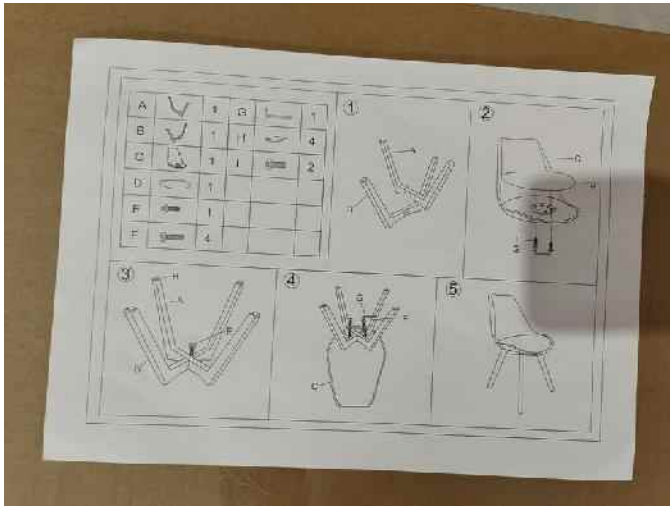

IM



Spare parts



Assembly process



Assembly process



Assembly process



Assembly process





Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED

## Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup> ,2022

Total page: 63



Product view



Product view



Product view



Product view



Product view



Product view



Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup>, 2022

Total page: 63



N/A

SCANDINAVIA ECONOMY: glue mark-minor

N/A

## TEST PHOTOS



Carton size



Carton size





Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup> ,2022

Total page: 63

**Carton weight**



**Carton weight**



**loading test(150kgs)**



**loading test(150kgs)**



**loading test(150kgs)**



**loading test**



**Steady test**

**Steady test**

This report only reflects the truth of quality in this lots goods, based on statistical sampling procedure. Inspection is performed to the best of our ability and skills but without responsibility on our part, nor does it evidence shipment. Our Website: [www.qgs.com.cn](http://www.qgs.com.cn)





Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup> ,2022

Total page: 63



**Steady test**



**Steady test**



**loading test**



**loading test**



**loading test**



**loading test**



Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup> ,2022

Total page: 63



Moisture test



Moisture test



Moisture test



Moisture test



Adhesive test



Adhesive test





Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup>, 2022

Total page: 63



Scanning barcode



Scanning barcode



Scanning barcode



Scanning barcode



Scanning barcode



Scanning barcode





Quality Assure In China

China Inspection  
Office

# HK QGS LIMITED Final Random Inspection Report

Client Ref. No.: 2216

Report No.:2216008

Date: July 10<sup>th</sup> ,2022

Total page: 63



On site



On site



On site



The factory

END